




**AMERICAN SPECIALTIES, INC.**  
441 Saw Mill River Road, Yonkers, NY 10701 (914) 476-9000

MODEL No: 64676

ISSUED: 1-87

REVISED: 4-03

**RECESSED PAPER TOWEL DISPENSER AND WASTE RECEPTACLE**

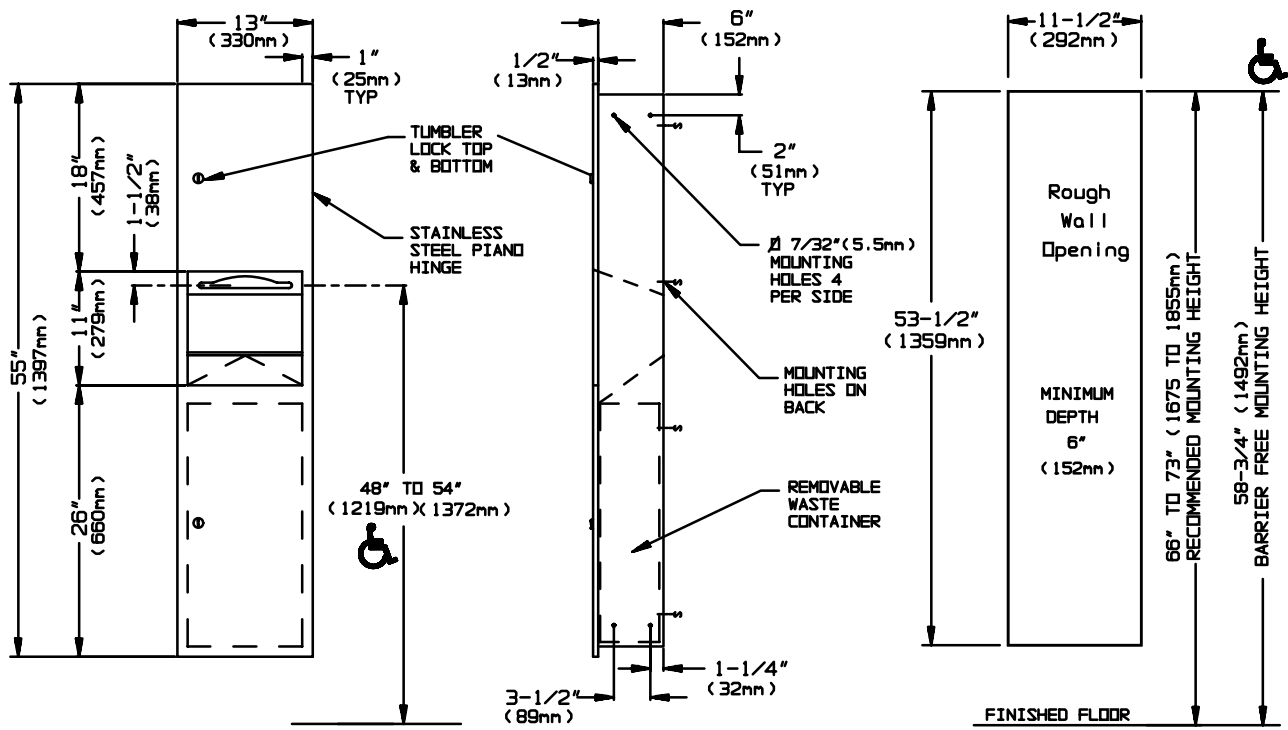

**SPECIFICATION**

Recessed Paper Towel Dispenser and Waste Receptacle shall hold and dispense 800 standard multi-fold or 600 standard C-fold or 1100 standard single-fold paper towels and shall have a waste capacity of 7 gal (26.5liters). Towel dispenser, door, frame, waste container and cabinet shall be fabricated of alloy 18-8 stainless steel, type 304. Cabinet shall be N° 20 gauge, with a 1" (25mm) wide perimeter return to lay flat against wall. Full face door shall be N°18 gauge with a 1/2" (13mm) square return to wall with no visible open seams on door face. Door shall be attached to the cabinet at side with a full length 3/16" (5mm) dia. stainless steel multi-staked piano hinge and shall be held closed with tumbler locks keyed alike to other ASI Washroom Equipment. Towel dispensing slot shall have a fully hemmed-in rolled edge for snag-free dispensing and user safety. Waste container shall have hemmed edges for safety. Structural assembly of all components shall be of welded construction. Waste receptacle door shall be attached to cabinet with a spring-loaded stainless steel piano hinge and shall have the international waste symbol on face. Adjustable guide shall be provided to allow dispensing of single-fold, multi-fold or C-fold paper towels.

**Recessed Paper Towel Dispenser and Waste Receptacle shall be Model N° 64676 as manufactured by American Specialties, Inc., 441 Saw Mill River Road, Yonkers, New York 10701-4913**

**INSTALLATION**

Unit is mounted in wall recess using N°10 self tapping screws (by others) through concealed mounting holes provided. Note that top of rough wall opening is 3/4" (19mm) below top of unit.

**Rough Wall Opening required is..... 11-1/2"W x 53-1/2"H x 6"D. minimum (292mm x 1359mm x 152mm)**

**OPERATION**

Towels are self-feeding until supply is depleted. Unit may be reloaded with a partial load in-place and will continue to feed properly. Waste container is emptied manually on cycle determined by maintenance needs. Adapter permits changing from C-fold to multi-fold towel dispensing.